

S-2 SURFACE

SLAT OPTIONS

- "CEDAR" RECYCLED PLASTIC
- "GREY" RECYCLED PLASTIC
- "REDWOOD" RECYCLED PLASTIC
- "GREEN" RECYCLED PLASTIC
- OTHER \_\_\_\_\_

NOTES

- 1.) ALL STL. MEMBERS COATED W/ ZINC RICH EPOXY THEN FINISHED W/ BLACK POLYESTER POWDER COATING.
- 2.) 1/2" X 3 3/4" EXPANSION ANCHOR BOLTS PROVIDED FOR S-2 OPTION.

**DuMor, inc.**  
P.O. Box 142 Mifflintown, PA 17059-0142




SCALE : NONE  
DATE DRAWN : 7/11/03  
DRAWN BY : AH  
DATE REV. : 4/6/06  
REV. BY : JSB

TITLE : RECEPTACLE

REV. B

DRAWING NUMBER 41-22PL/46-00

SHEET 1 OF 2

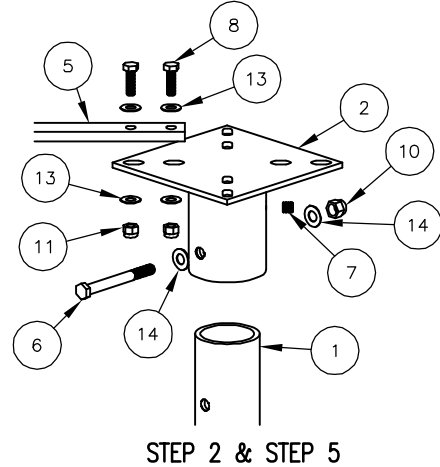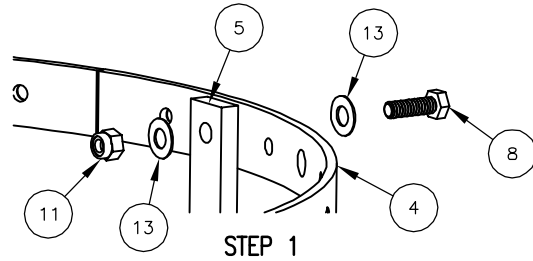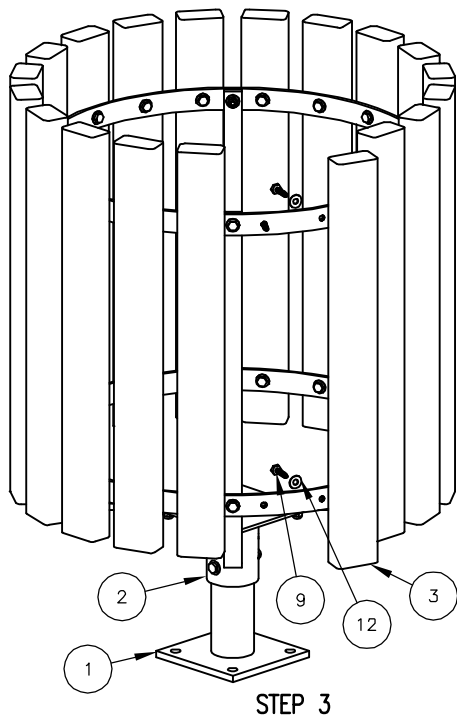

**NOTE:**

- 1.) DURING ASSEMBLY PROCEDURE:  
DO NOT COMPLETELY TIGHTEN HARDWARE.
- 2.) THE ACTUAL PARTS WILL NOT BE NUMBERED:  
NUMBERS ONLY APPLY TO DRAWING.
- 3.) SEE SPEC. SHEET 1 FOR OTHER MOUNTING OPTIONS.
- 4.) 2 HOLES IN HOOPS ( 1/2" DIA. ) TO BE LEFT OPEN.

**STEP 1:**

- USE 2 - PCS. HOOP FOR 20 GAL ( 4 )  
 4 - PCS. "L" SUPPORT STRAP FOR 20 GAL ( 5 )  
 8 - PCS. 5/16" X 1" SS. HEX HD. CAP SCR. ( 8 )  
 8 - PCS. 5/16" SS. NYLON LOCK NUT ( 11 )  
 16 - PCS. 5/16" SS. FLAT WASHER ( 13 )
- ATTACH "L" SUPPORT STRAP ( 5 ) TO HOOP ( 4 ) USING HARDWARE ( 8, 11, & 13 ). TIGHTEN TO SNUG FIT. REPEAT UNTIL ALL "L" SUPPORT STRAPS ARE ATTACHED TO HOOPS.

**STEP 2:**

- USE 1 - PC. CENTER BRACKET ( 2 )  
 8 - PCS. 5/16" X 1" SS. HEX HD. CAP SCR. ( 8 )  
 8 - PCS. 5/16" SS. NYLON LOCK NUT ( 11 )  
 16 - PCS. 5/16" SS. FLAT WASHER ( 13 )
- ATTACH CENTER BRACKET TO STEP 1 ASSEMBLY USING HARDWARE ( 8, 11, & 13 ). TIGHTEN TO SNUG FIT.

**STEP 3:**

- USE 20 - PCS. 2" X 3" X 23 3/4" PLASTIC SLAT ( 3 )  
 40 - PCS. 1/4" X 1 1/4" SS. HEX HD. LAG SCR. ( 9 )  
 40 - PCS. 1/4" SS. FLAT WASHER ( 12 )
- ATTACH 2" X 3" X 23 3/4" PLASTIC SLATS ( 3 ) TO STEP 2 ASSEMBLY USING HARDWARE ( 9 & 12 ). TIGHTEN TO SNUG FIT. REPEAT UNTIL ALL SLATS ARE ATTACHED.

**STEP 4:**

UPON COMPLETION OF BASKET ASSEMBLY SQUARE ALL COMPONENTS THEN TIGHTEN ALL HARDWARE.

**STEP 5:**

- USE 1 - PC. SUPPORT FOR SURFACE MOUNT ( 1 )  
 1 - PC. 3/8" X 3 1/2" SS. HEX HD. CAP SCR. ( 6 )  
 1 - PC. 3/8" SS. NYLON LOCK NUT ( 10 )  
 2 - PC. 3/8" SS. FLAT WASHER ( 14 )  
 2 - PCS. 3/8" X 3/8" SS. SKT. SET SCR. ( 7 )
- ATTACH SURFACE MOUNT SUPPORT ( 1 ) TO STEP 4 ASSEMBLY USING HARDWARE ( 6, 10, 14, & 7 ) AND TIGHTEN ALL HARDWARE.


**STEP 6:**

TO ATTACH COVER, REMOVE ONE 1/4" X 1 1/4" LAG SCREW AND FASTEN OPEN END OF CABLE TO BASKET USING THE LAG REMOVED.

**STEP 7:**

MOUNT AND ANCHOR AS SPECIFIED.

ITEM	QTY	PART NO	DESCRIPTION
1	1	0-41-00-03/S-2	SUPPORT FOR SURFACE MOUNT
2	1	0-41-00-04	CENTER BRACKET
3	20	0-41-20PL-01	2" X 3" X 23 3/4" RECYCLED PLASTIC SLAT
4	2	0-41-20-02	HOOP FOR 20 GAL ( 21 11/16" DIA )
5	4	0-41-20-05	"L" SUPPORT STRAP FOR 20 GAL
6	1	1-12-034	3/8" X 3 1/2" SS HEX HD CAP SCR
7	2	1-12-054	3/8" X 3/8" SS SKT SET SCR
8	16	1-12-061	5/16" X 1" SS HEX HD CAP SCR
9	40	1-13-004	1/4" X 1 1/4" SS HEX HD LAG SCR
10	1	1-20-007	3/8" SS NYLON LOCKNUT
11	16	1-20-016	5/16" SS NYLON LOCKNUT
12	40	1-22-006	1/4" SS FLAT WASHER
13	32	1-22-017	5/16" SS FLAT WASHER
14	2	1-22-024	3/8" SS FLAT WASHER



**DuMor, inc.**

P.O. Box 142 Mifflintown, PA 17059-0142

SCALE : NONE  
 DATE DRAWN : 7/11/03  
 DRAWN BY : AH  
 DATE REV. : 4/6/06  
 REV. BY : JSB

TITLE : RECEPTACLE ASSEMBLY

REV. B

DRAWING NUMBER 41-22PL/46-00

SHEET 2 OF 2